

DENSI CALIBRATION STEPS

- Switch off the indicator
- Switch on the indicator by pressing **3 (F3)** key.
- It writes **tEst** on the screen. Press **3 (F3)** key again.
- It writes **St.CaL** on the screen. Press **SET** key.
- It writes **d XXXX** on the screen. Press **SET** key.
- It writes **C XXXX** on the screen. This is the capacity of weighbridge. Write the capacity of weighbridge. If it is same don't change it. Press **SET** key.
- It writes **d XXXX** on the screen. Press **SET** key.
- It writes **S XXXX** on the screen. Please write the value of total scale. This is the amount of total scale we put on the weighbridge. Total scale should be minimum 1/10 of capacity (For Example: If the capacity is 5000KG, you should put total scale minimum 500KG). Please write by keyboard on the indicator and press **SET** key.
- It writes **LoAd** on screen. Now you can load the scales to the weighbridge. Scales should be placed with balanced. If scales are ready press **SET** key.
- It writes **XXXXXX** on screen. Press **SET** key again.
- It writes **End** on screen. Now please unload scales step by step and check the value on indicator.

Now the calibration is okay. You can check the values.

NOTE : These steps are used for calibrating the indicators that are the supervisor's first setup. If you need to change capacity or steps, please contact with Prokser.